



2.CERTIFICATE OF EXAMINATION

ASH 922

Complete

Score	56 / 56 (100%)	Flagged items	0	Actions	0
-------	----------------	---------------	---	---------	---

Site conducted

Ashvale Head Office

Conducted on

22 Jan 2026 10:24 AM GMT

Prepared by

B.P

Location

Sunnyside, Toddington Road
Bedford
England
MK45 5AH
United Kingdom
(51.97295465699442,
-0.5074228190382343)

Asset

ASH 922
9 Ton Dumper - Dumper
9TMecalac TA9

Asset serial number

SLBD1DP0EN1TP1038

Asset hours

930

Supply multiple photo's of asset - all sides, any damage etc



Photo 1



Photo 2



Photo 3



Photo 4



Photo 5



Photo 6

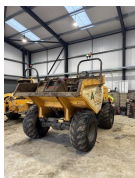


Photo 7



Photo 8

Power unit	11 / 11 (100%)
Oil level	Acceptable
Water/Antifreeze level	Acceptable
Belt tension/Condition	Acceptable
Mountings	Acceptable
Emissions/Exhaust	Acceptable
Oil leaks	Acceptable
Hoses & pipes	Acceptable
Gauges/Warning indicators	Acceptable
Turbo	Acceptable
Air cleaner/Indicator	Acceptable
Spark Arrestor	Acceptable

Transmission	5 / 5 (100%)
Oil levels/Leaks	Acceptable
Controls/Operations	Acceptable
Drive shafts/Axles	Acceptable
Hub reduction units/levels	Acceptable
Transfer box/levels	Acceptable

Brakes	5 / 5 (100%)
Air/Hydraulic leaks	Acceptable
Drums/Discs/Pads/Shoes	Acceptable
Foot/Hand controls	Acceptable
Cables/Rods/Pipes	Acceptable
Fluid levels/Efficiency	Acceptable

Steering		6 / 6 (100%)
Box/Column/Wheel		Acceptable
King Pins/Bushes		Acceptable
Ramp/Pump/Hoses		Acceptable
Track Rods/Steering Arms		Acceptable
Linkages/Ball joints		Acceptable
Oil levels/Leakes		Acceptable

Running Gear		5 / 5 (100%)
Tyres/Wheels/Tracks		Acceptable
Wheel bearings		Acceptable
Axle security		Acceptable
Over run brake rods/cable		Acceptable
Towing/Frame Attachments		Acceptable

Fuel System	4 / 4 (100%)
Fuel tank/Security	Acceptable
Fuel line/leaks	Acceptable
Filters/Pumps	Acceptable
Fuel level/Gauge	Acceptable

Hydraulics		5 / 5 (100%)
Rams		Acceptable
Pumps/Hoses/Pipes		Acceptable
Safety indicators		Acceptable
Oil levels/leaks		Acceptable
Controls		Acceptable

Electrical	10 / 10 (100%)
Battery	Acceptable
Alternator/Charging	Acceptable
Battery was at 11.5v so jumped machine, alternator is charging at 14.2v which is good and left running and starts first time i believe the green beacon was left on. But all okay now	
Wiring	Acceptable
Fuses/Circuit breakers	Acceptable
Lights/Indicators	Acceptable
Warning Indicators	Acceptable
Outlet sockets	Acceptable
Limit/Proximity switches	Acceptable
Safety Devices	Acceptable
Warning Devices	Acceptable

Cab	5 / 5 (100%)
Seating/Belts	Acceptable
Structure/Rops	Acceptable
Glass/Mirrors	Acceptable
Mountings	Acceptable
Safe access to components, struts and hinges all in working order	Yes

Sign off

Engineers name & signature

A handwritten signature in black ink, appearing to be 'BP', on a light gray background.

Brandon Perry
22 Jan 2026 10:29 AM GMT

Media summary



Photo 1



Photo 2

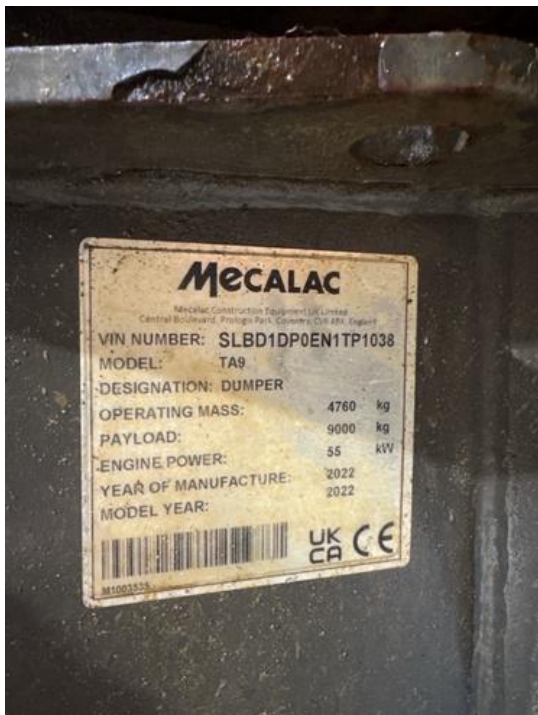


Photo 3



Photo 4



Photo 5



Photo 6



Photo 7



Photo 8